

#	Device/System	Location	Activity
1	R:KPS1C	MI-14	Repair
2	S:FSEP	G2	Troubleshooting
3	R:KPS5A	MI-52	Troubleshooting
4	I:HT818	MI-8	Troubleshooting

Details	Status
System tripped with Reservoir Power Out Of Limit indication repeatedly. Re-terminated a failed cable termination.	Complete
Vacuum burst when FSEPs were moved into beam. Assisted MSD in determining if FSEP tanks were open or shorted. No hard short found. FSEPs turned up to full voltage when vacuum recovered.	Complete
System tripped with Thyatron Pre-Fire indications occasionally. Did not see an actual Pre-Fire. Replaced the Magnet Sample/Hold Card for now.	Ongoing
I:HT818D readback noise causing excessive alarms. It is not the switcher module. Asking Controls to repair/replace the MADC.	Complete